

Work Order ID 70566

Monday, June 13, 2011 10:07:41 AM



Page 1

Item ID: D2221

Accept



Setup Start



Revision ID:

Item Name: 350 Basket Base

Stop



Start Date: 6/10/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 6/22/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: HL

Date: 11-06-13

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr

Revision Nbr

D2221

Rev H

100

0.00



Large Fab

Large Fab

Memo

0.00

Large Fab

1- assemble all ribs and both D2581 in DT9444 jig, weld as per dwg D2221
2- remove basket from jig and weld D3442-1 shims and D2232-3 hinges as per dwg D2221
3- tack weld mesh on basket as per dwg D2221
A/R ER316 S.S. Rod Batch: M115778

PLEASE NOTE

IF MAKING -041A OR -043A :
DRILL HOLES FOR GAS SPRING
IN D3825-041 AS PER
DSI 9473

110

QC9- Inspect visual per QSI004- Fusion Welds

0.00



QC

Memo

0.00

Quality Control

11.06.28

11.06.29

P70

Dart Aerospace Ltd

W/O: 70566		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
11.07.04	100	- 043A req'd - Grind flush D2327-3 bushing - Trim steel mesh locally A/R - transfer drill 2x 0.194 holes thru basket lid sq tube + 2x 0.194 holes thru basket base sq tube per DST 9473	Cpl	11.07.04	1	W	S 11/7/05
11.07.04	100	- QC5	S	11/07/04	(X)	11-07-04	
11.07.04	100	touch up A/R Repowdercoat entire basket	M/A	11/07/04	(X)	11-07-04	11-07-04
11.07.04	100	- QC3	BL	11-7-5	(X)	W	S 11-7-05

Part No: D2221 PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 70566

Monday, June 13, 2011 10:07:41 AM



Page 2

Item ID: D2221

Accept



Setup Start



Revision ID:

Item Name: 350 Basket Base

Stop



Start Date: 6/10/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 6/22/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

120

0.00



QC

QC6- Inspect dimensions to drawing

Memo

0.00

Quality Control

8 u/06/29

125

0.00



HandFinish

Pressure Wash per QSI005 4.3

Memo

0.00

Hand Finishing

1 of 8 u/06/29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

[illegible]

Page 3

Accept

**Setup Start**

Stop

[illegible]**Cust Item ID:**

1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100 101 102 103 104 105 106 107 108 109 110 111 112 113 114 115 116 117 118 119 120 121 122 123 124 125 126 127 128 129 130 131 132 133 134 135 136 137 138 139 140 141 142 143 144 145 146 147 148 149 150 151 152 153 154 155 156 157 158 159 160 161 162 163 164 165 166 167 168 169 170 171 172 173 174 175 176 177 178 179 180 181 182 183 184 185 186 187 188 189 190 191 192 193 194 195 196 197 198 199 200 201 202 203 204 205 206 207 208 209 210 211 212 213 214 215 216 217 218 219 220 221 222 223 224 225 226 227 228 229 230 231 232 233 234 235 236 237 238 239 240 241 242 243 244 245 246 247 248 249 250 251 252 253 254 255 256 257 258 259 260 261 262 263 264 265 266 267 268 269 270 271 272 273 274 275 276 277 278 279 280 281 282 283 284 285 286 287 288 289 290 291 292 293 294 295 296 297 298 299 300 301 302 303 304 305 306 307 308 309 310 311 312 313 314 315 316 317 318 319 320 321 322 323 324 325 326 327 328 329 330 331 332 333 334 335 336 337 338 339 340 341 342 343 344 345 346 347 348 349 350 351 352 353 354 355 356 357 358 359 360 361 362 363 364 365 366 367 368 369 370 371 372 373 374 375 376 377 378 379 380 381 382 383 384 385 386 387 388 389 390 391 392 393 394 395 396 397 398 399 400 401 402 403 404 405 406 407 408 409 410 411 412 413 414 415 416 417 418 419 420 421 422 423 424 425 426 427 428 429 430 431 432 433 434 435 436 437 438 439 440 441 442 443 444 445 446 447 448 449 450 451 452 453 454 455 456 457 458 459 460 461 462 463 464 465 466 467 468 469 470 471 472 473 474 475 476 477 478 479 480 481 482 483 484 485 486 487 488 489 490 491 492 493 494 495 496 497 498 499 500 501 502 503 504 505 506 507 508 509 510 511 512 513 514 515 516 517 518 519 520 521 522 523 524 525 526 527 528 529 530 531 532 533 534 535 536 537 538 539 540 541 542 543 544 545 546 547 548 549 550 551 552 553 554 555 556 557 558 559 560 561 562 563 564 565 566 567 568 569 570 571 572 573 574 575 576 577 578 579 580 581 582 583 584 585 586 587 588 589 590 591 592 593 594 595 596 597 598 599 600 601 602 603 604 605 606 607 608 609 610 611 612 613 614 615 616 617 618 619 620 621 622 623 624 625 626 627 628 629 630 631 632 633 634 635 636 637 638 639 640 641 642 643 644 645 646 647 648 649 650 651 652 653 654 655 656 657 658 659 660 661 662 663 664 665 666 667 668 669 670 671 672 673 674 675 676 677 678 679 680 681 682 683 684 685 686 687 688 689 690 691 692 693 694 695 696 697 698 699 700 701 702 703 704 705 706 707 708 709 710 711 712 713 714 715 716 717 718 719 720 721 722 723 724 725 726 727 728 729 730 731 732 733 734 735 736 737 738 739 740 741 742 743 744 745 746 747 748 749 750 751 752 753 754 755 756 757 758 759 760 761 762 763 764 765 766 767 768 769 770 771 772 773 774 775 776 777 778 779 780 781 782 783 784 785 786 787 788 789 790 791 792 793 794 795 796 797 798 799 800 801 802 803 804 805 806 807 808 809 810 811 812 813 814 815 816 817 818 819 820 821 822 823 824 825 826 827 828 829 830 831 832 833 834 835 836 837 838 839 840 841 842 843 844 845 846 847 848 849 850 851 852 853 854 855 856 857 858 859 860 861 862 863 864 865 866 867 868 869 870 871 872 873 874 875 876 877 878 879 880 881 882 883 884 885 886 887 888 889 890 891 892 893 894 895 896 897 898 899 900 901 902 903 904 905 906 907 908 909 910 911 912 913 914 915 916 917 918 919 920 921 922 923 924 925 926 927 928 929 930 931 932 933 934 935 936 937 938 939 940 941 942 943 944 945 946 947 948 949 950 951 952 953 954 955 956 957 958 959 960 961 962 963 964 965 966 967 968 969 970 971 972 973 974 975 976 977 978 979 980 981 982 983 984 985 986 987 988 989 990 991 992 993 994 995 996 997 998 999 1000 1001 1002 1003 1004 1005 1006 1007 1008 1009 1010 1011 1012 1013 1014 1015 1016 1017 1018 1019 1020 1021 1022 1023 1024 1025 1026 1027 1028 1029 1030 1031 1032 1033 1034 1035 1036 1037 1038 1039 1040 1

Customer:

Reference:

Run Start

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

**Insp.
Stamp**

0.00

Abstract

Powdercoat

Powder Coating

Memo

0.00

-1- Plug holes prior to 11 11 7745

1ST COAT:

START TIME: 2:00 PM

OVEN TEMPERATURE: 460 °C

FINISH TIME: 2:30 p.m.

*****2nd coat if necessary*****

2ND COAT:

START TIME 3:15

OVEN TEMPERATURE: 400°

FINISH TIME: 3:45

0.00



QC

Quality Control

Memo

0.00

1 BK 11-6-29

1 of 1106130

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 70566

Monday, June 13, 2011 10:07:41 AM



Page 4

Item ID: D2221

Accept



Setup Start



Revision ID:

Item Name: 350 Basket Base

Stop



Start Date: 6/10/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 6/22/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

150

Identify as per dwg & Stock Location: GA 0.00

Packaging

Memo

W/O 71227 0.00

0.00

Packaging

11/07/05 ①

160

QC21- Final Inspection - Work Order Release 0.00



QC

Memo

0.00

Quality Control

11/7/05 ②ME
11-07-05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, June 13, 2011 10:07:51 AM

Page 1

Work Order ID: 70566

Parent Item: D2221

Parent Item Name: 350 Basket Base




Start Date: 6/10/2011

Required Date: 6/22/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:J 05.09.02 Added D3442-1 ☐ KJ/JLM
 IPP Rev:K 08-08-29 revG as per dwg DD verified by:EC
 IPP Rev:L 08-09-24 plug holes prior to powder coat DD verified by:EC
 IPP Rev:M 08-12-02 revH as per dwg DD verified by:EC IPP Rev:N
 10.06.29 added pressure wash DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2221-1  Rib		Manufactured	No			100	Each	17.0000	1	1			
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				WA				8					
				69261				8					
				WA006				9					
				67465				9					
D2221-5  Rib		Manufactured	No			100	Each	12.0000	2	2			
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				WA006				12					
				67117				2					
				67399				2					
				69257				8					
D2221-7  Rib		Manufactured	No			100	Each	6.0000	1	1			
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				WA				4					
				70130				4					
				WA006				2					
				67274				2					



SAD 11-06-23



SAD 11-08-23



SAD 11-06-23

① ~~WA~~

~~WA~~

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, June 13, 2011 10:07:51 AM

Page 2

Work Order ID: 70566

Parent Item: D2221

Parent Item Name: 350 Basket Base

Start Date: 6/10/2011

Required Date: 6/22/2011

Start Qty: 1.00

Required Qty: 1.00

D2232-3 Manufactured No

100 Each

10.0000

2

2



Basket Hinge



SAD 11-06-23

Location

Loc Qty

Loc Code

WA005

10

69211

10

2

D2235-1

Manufactured No

100 Each

16.0000

2

2



Basket Rib



SAD 11-06-23

Location

Loc Qty

Loc Code

WA

12

68606

2

69651

10

2

WA005

4

66895

4

D2581

Manufactured No

100 Each

74.0000

2

2



Mounting Bracket



SAD 11-06-23

Location

Loc Qty

Loc Code

WA

74

68964

6

69258

28

69739

40

2

D3442-1

Manufactured No

100 Each

7.0000

2

2



Shim



SAD 11-06-23

Location

Loc Qty

Loc Code

WA005

7

64271

2

65783

5

2

2

Monday, June 13, 2011 10:07:51 AM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, June 13, 2011 10:07:51 AM

Page 3

Work Order ID: 70566

Parent Item: D2221



Parent Item Name: 350 Basket Base

Start Date: 6/10/2011

Required Date: 6/22/2011



Start Qty: 1.00

Required Qty: 1.00

D3825-041 Manufactured No 100 Each 2.0000 2 2
  SAD 11-06-23
 Rib Assembly (Basket End)



Location	Loc Qty	Loc Code
WA	2	2
69984	2	

870426



D3826-041 Manufactured No 100 Each 2.0000 2 2
  SAD 11-06-23
 Rib / Gusset Assembly

Location	Loc Qty	Loc Code
WA	2	2
67464	2	



870117

D3827-041 Manufactured No 100 Each 6.0000 1 1
  SAD 11-06-23
 Rib Assembly (Inboard)

Location	Loc Qty	Loc Code
WA	6	
69114	6	

D3832-1 Manufactured No 100 Each 3.0000 1 1
  11-06-28
 Mesh (Base)

Location	Loc Qty	Loc Code
WA	3	
69173	3	

D3833-1 Manufactured No 100 Each 9.0000 2 2
  11-06-28
 Mesh (Base End Face)

Location	Loc Qty	Loc Code
WA	9	
67459	9	

Monday, June 13, 2011 10:07:51 AM

Shop Packet Print

Page 3


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

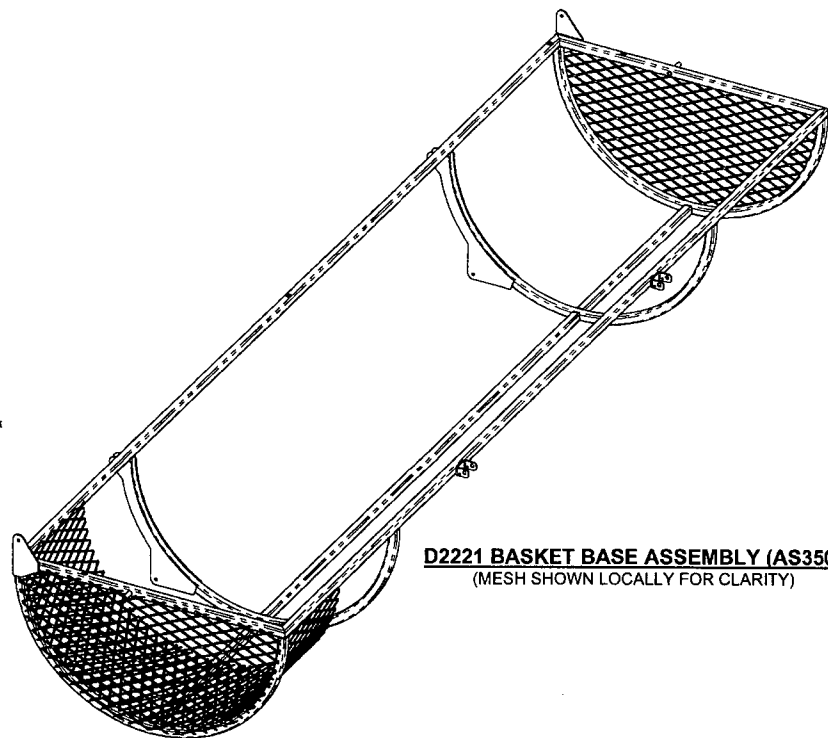

D2221 BASKET BASE ASSEMBLY (AS350)
(MESH SHOWN LOCALLY FOR CLARITY)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 70566
PH 11-06-13

ITEM	QTY	P/N	DESCRIPTION
1	X	D2221	BASKET BASE ASSEMBLY (AS350)
2	1	D2221-1	RIB
3	2	D2221-5	RIB
4	1	D2221-7	RIB
5	2	D2232-3	BASKET HINGE
6	2	D2235-1	RIB
7	2	D2581	MOUNTING BRACKET
8	2	D3442-1	SHIM
9	2	D3825-041	RIB ASSY (BASKET END)
10	2	D3826-041	RIB/GUSSET ASSY
11	1	D3827-041	RIB ASSY (INBOARD)
12	2	D3833-1	MESH, BASE END FACE
13	1	D3832-1	MESH (BASE)

RELEASED
08/11/18

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: POWDER COAT GLOSS WHITE (4.3.5.2) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: 42.00 lbs APPROX
- 8) MASK ALL HOLES PRIOR TO POWDER COATING

H	REVISED PARTS LIST AND ADDED "ITEM" COLUMN TO PARTS LIST (ZN D3-1); REVISED SECTIONS A-A, B-B AND C-C (ZN C6-3, C2-3 AND A6-3); REVISED DETAIL D (ZN B7-4); ADDED DETAIL E (ZN A6-4); ADDED SECTION F-F (ZN B2-4); ADDED DWG DETAILS FOR D2221-1/5/7 (SHEET 5); TOL REVISED TO 2 DEC PLACES (ZN D8-3 AND ZN B4-3); D3825-041 REPLACES D2221-3/D2327-3; D3826-041 REPLACES D2235-1/D2325; D3827-041 REPLACES D2221-1 ON INBOARD SIDE; ADDED D3832-1 AND D3833-1. REASON: SATISFY "LEAN MANUFACTURING" PROGRAM.	MB	08.09.18
G	MATERIAL FOR -1, -3, -5 & -7 WAS 0.060 WALL; TOLERANCE FOR 96.00 DIM WAS +/-0.01 AND 56.00 DIM WAS REF (ZN B5-2); 19.62 DIM WAS "HARD" DIMENSION IS NOW "REF" (ZN B4-2); NOTE 5 TRANSFERRED FROM SHT 1 TO SHT 2; SHT 2 MESH MATERIAL UPDATED; DRAWING TRANSFERRED TO "B" FORMAT	AJS	08.06.16
F	ADD SHIM UNDER HINGE; ADD HOLES FOR SPLIT LID BASKET	PH	05.06.07
E	CHANGE HINGE	CP	01.04.19
D	CHANGE LATCH	BW	96.06.21
C	SEPARATE BASKET AND LID	KH	95.11.21
REV.	DESCRIPTION	BY	DATE
DESIGN	BW	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN			
CHECKED	ASS	DRAWING NO.	REV. H
MFG. APPR.		D2221	SHEET 1 OF 5
APPROVED		TITLE	SCALE
DE APPR.		BASKET BASE ASSEMBLY (350)	NTS
DATE	08.09.18	<small>COPYRIGHT © 1994 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____



NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

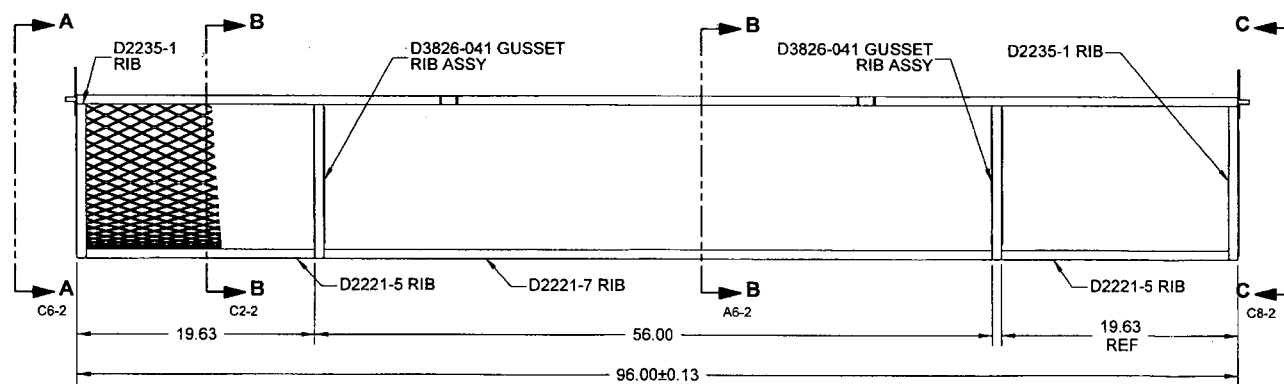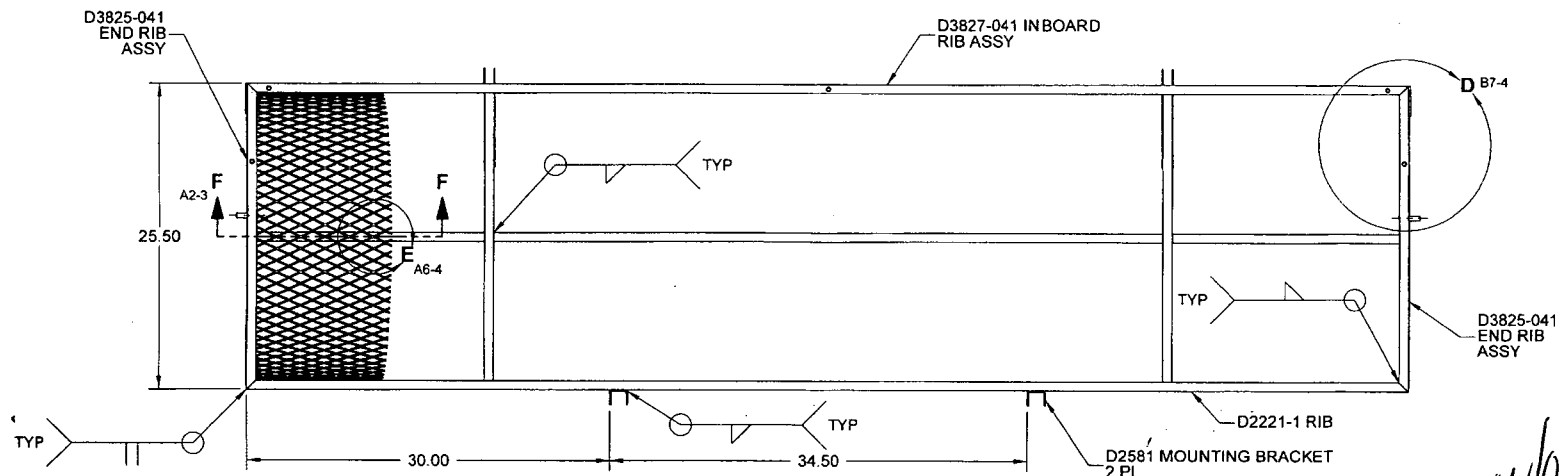

D2221 BASKET BASE ASSEMBLY (350)
(MESH SHOWN LOCALLY FOR CLARITY)

RELEASED
06/11/18 NAD

DESIGN	BW	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D2221	SHEET 2 OF 5
APPROVED		TITLE	SCALE
DE APPR.		BASKET BASE ASSEMBLY (350)	NTS
DATE	08.09.18	COPYRIGHT © 1994 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

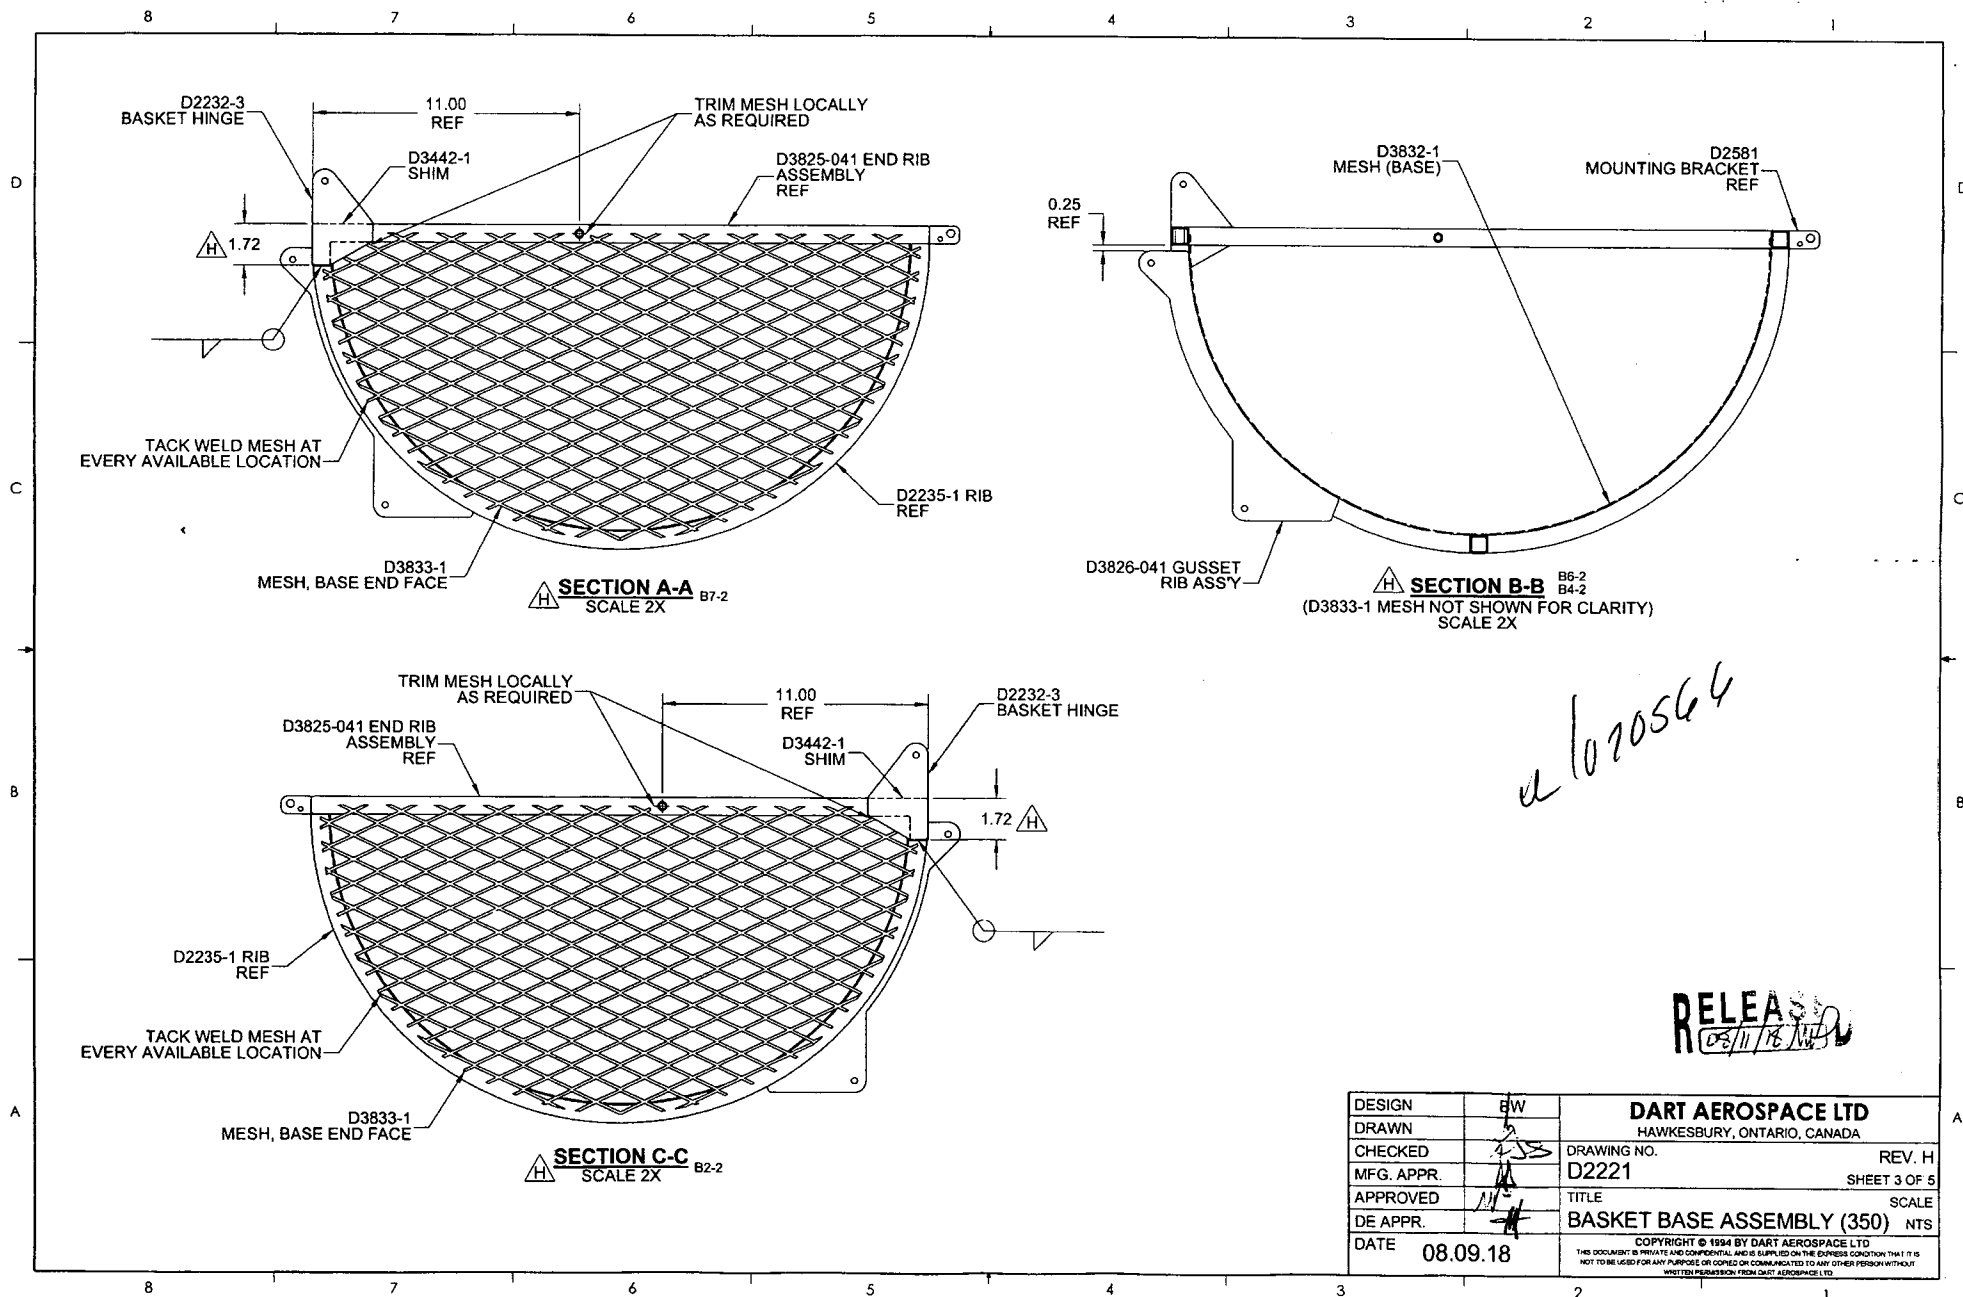

DESIGN	BW	DART AEROSPACE LTD	
DRAWN	2	HAWKESBURY, ONTARIO, CANADA	
CHECKED	455	DRAWING NO.	REV. H
MFG. APPR.	11	D2221	SHEET 3 OF 5
APPROVED	11	TITLE	SCALE
DE APPR.	11	BASKET BASE ASSEMBLY (350)	NTS
DATE	08.09.18	COPYRIGHT © 1994 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

8 7 6 5 4 3 2 1

D

D

C


C

B


B

A


A

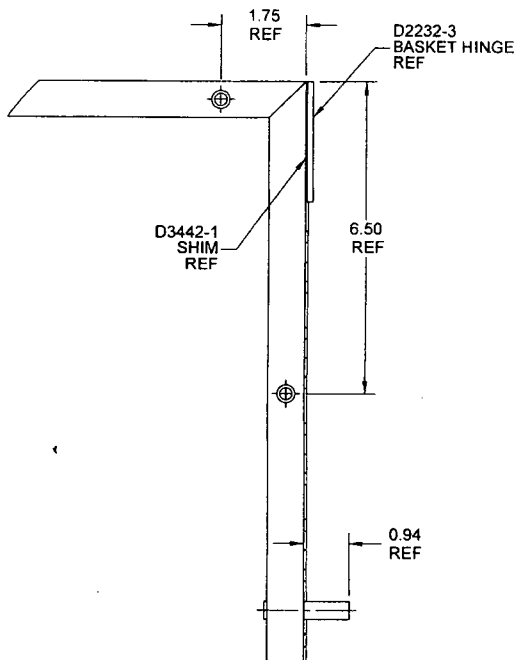

DETAIL D
SCALE 4X D2-2

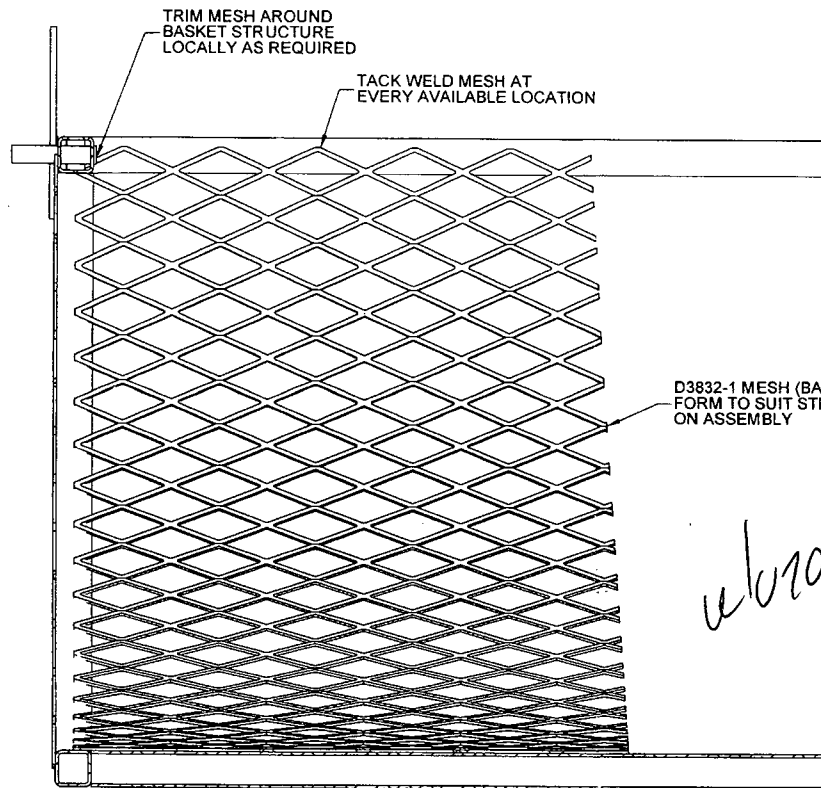

SECTION F-F
SCALE 4X D7-2

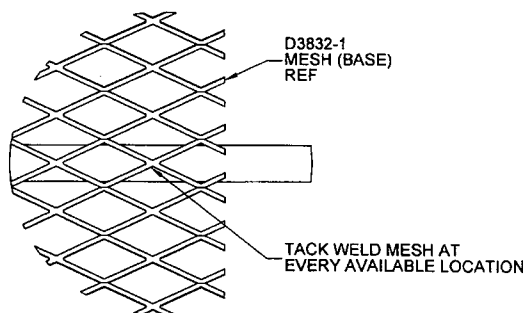

DETAIL E
SCALE 4X C6-2

W070566

RELEASED
02/11/16

DESIGN	BW	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO. D2221	REV. H
MFG. APPR.	<i>[Signature]</i>		SHEET 4 OF 5
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	BASKET BASE ASSEMBLY (350)	NTS
DATE	08.09.18	<small>COPYRIGHT © 1994 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

8 7 6 5 4 3 2 1





W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

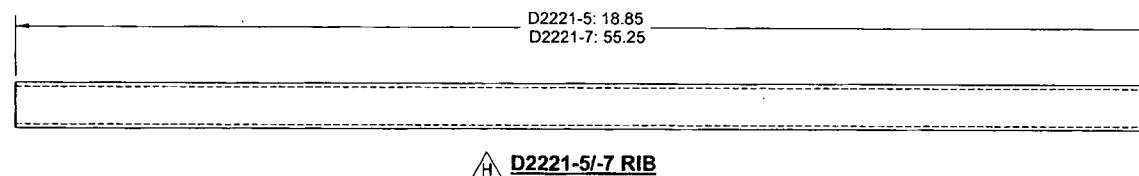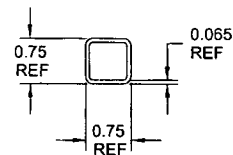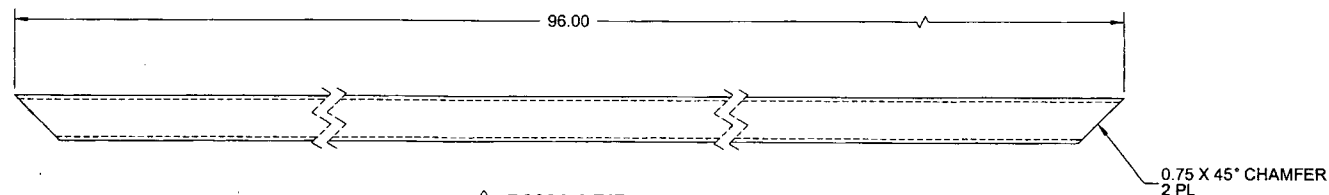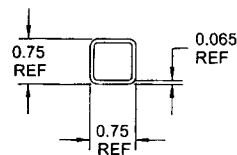

70504

RELEASED
08/11/18

NOTES:

- 1) MATERIAL: AISI 304/316 STAINLESS STEEL SQUARE TUBE, 0.75 X 0.75 X 0.065 WALL
REF. DART SPEC. M304TS0.750W0.065
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: N/A
- 8) WEIGHT: D2221 -1 = 4.57 lbs; D2221-5 = 0.90 lbs; D2221-7 2.65 = lbs

DESIGN	BW	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	APSS	DRAWING NO.	REV. H
MFG. APPR.	MD	D2221	SHEET 5 OF 5
APPROVED	W	TITLE	SCALE
DE APPR.	W	BASKET BASE ASSEMBLY (350)	NTS
DATE	08.09.18	<small>COPYRIGHT © 1994 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART SERVICE INSTRUCTION

TO AMEND DRAWING D350-607 REV. F OR SUBSEQUENT APPROVED REVISION

REF CANADIAN STC: SH94-14

FAA STC: SR00213NY

EASA STC: EASA.IM.R.S.01405

THE PURPOSE OF THIS DART SERVICE INSTRUCTION (DSI), IS TO PROVIDE OPERATORS OF AS350 / 355 ROTORCRAFT EQUIPPED WITH DART D350-607-041 HELI UTILITY BASKETS WITH AN UPGRADE KIT TO REPLACE THE EXISTING LID PROP ARM WITH 2 GAS SPRINGS.

FOR OPERATORS EQUIPPED WITH D350-607-043/-045/-047 HELI UTILITY BASKETS THIS DSI WILL PROVIDE AN UPGRADE KIT TO REPLACE THE EXISTING LID PROP ARM WITH 1 GAS SPRING.

ITEM No.	QTY -141	QTY -143	QTY -145	PART NUMBER	DESCRIPTION
1	X			D350-607-141	AUTOMATIC LID OPENER INSTL (FOR USE ON -041 BASKET*)
2		X		D350-607-143	AUTOMATIC LID OPENER INSTL (FOR USE ON -043/-047 BASKET*)
3			X	D350-607-145	AUTOMATIC LID OPENER INSTL (FOR USE ON -045 BASKET*)
4	2		1	D3953-1	GAS SPRING BRACKET
5	2	1	1	D3953-3	GAS SPRING STUD (LID)
6	2	1	1	D3953-5	GAS SPRING STUD (BASE)
7	2	1	1	D3953-7	GAS SPRING SPACER
8	4	2	2	D3953-9	GAS SPRING WASHER
9	2	1	1	D3953-11	GAS SPRING SPACER
10	2		1	D3953-13	GAS SPRING SPACER
11		1		D3953-15	GAS SPRING BRACKET
12		1		D3953-17	GAS SPRING SPACER
13	2	1	1	D3969-1	GAS SPRING
14	4	2	2	AN3C11A	BOLT
15		2		AN3C15A	BOLT
18	4		2	AN3C16A	BOLT
19	4	2	2	AN310-4	CASTELLATED NUT
20	8	4	4	MS21043-3	NUT
21	4	2	2	MS24665-212	COTTER PIN
22	8	4	4	NAS1149C0332R	WASHER (OR AN960C10L)
23	4	2	2	NAS1149C0432R	WASHER (OR AN960C416L)

***NOTE:** FOR CUSTOMERS WISHING TO ORDER NEW BASKETS WITH THE LID OPENER PRE-INSTALLED USE THE FOLLOWING NUMBERS:

D350-607-041 BASKET WITH AUTOMATIC LID OPENER INSTALLED = D350-607-041A

D350-607-043 BASKET WITH AUTOMATIC LID OPENER INSTALLED= D350-607-043A

D350-607-045 BASKET WITH AUTOMATIC LID OPENER INSTALLED = D350-607-045A

D350-607-047 BASKET WITH AUTOMATIC LID OPENER INSTALLED = D350-607-047A

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01




APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.11.11

CERT. NO.: SH94-14

ISSUE NO.: 4

C	SHEET 1 PL, -143 INSTL, ITEM 6 QTY WAS 2, ITEM 7 WAS 0.	AJS	09.11.11
B	SHT 1 P/L ITEM 22 WAS NAS1149C0332 ITEM 23 WAS NAS1149C0432H. ALL OTHER SHEETS UPDATED ACCORDINGLY. (REASON: DRAFTING ERROR) INSTALLATIONS RENAMED.	AJS	09.11.06
A	NEW ISSUE	AJS	09.09.15
REV.	DESCRIPTION	BY	DATE
DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

FOR D350-607-041 BASKETS, REPLACE THE EXISTING D2332-041 PROP ARM AS FOLLOWS:

D350-607-141 AUTOMATIC LID OPENER INSTALLATION

NOTE: ONCE THIS MODIFICATION IS COMPLETE YOU WILL NOT BE ABLE TO RE-INSTALL THE D2332-041 PROP ARM.




- 1) REMOVE THE D2332-041 PROP ARM.
 - 2) GRIND FLUSH THE D2327-3 SPACER BUSHING ON BOTH ENDS OF THE BASKET AS SHOWN IN FIGURE 1 (IT IS PERMISSIBLE TO GRIND ALL 4 SPACERS FLUSH). TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4.
 - 3) LOCATE THE D3953-1 GAS SPRING BRACKET AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET LID SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL A. INSTALL THE D3953-1 GAS SPRING BRACKET & D3953-13 GAS SPRING SPACER USING 2X AN3C16A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW E-E.
 - 4) LOCATE THE D3953-5 GAS SPRING STUD AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET BASE SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL E. FASTEN D3953-5 IAW VIEW F-F USING 2X AN3C11A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT.
 - 5) INSTALL 1X D3953-11 GAS SPRING SPACER ONTO THE D3953-5 STUD AS SHOWN IN VIEW F-F. INSTALL THE LARGE END OF THE D3969-1 GAS SPRING SPRING ONTO THE D3953-5 GAS SPRING STUD AND FASTEN IN PLACE USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW F-F. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
 - 6) INSERT THE D3953-3 GAS SPRING STUD INTO THE D3953-1 GAS SPRING BRACKET & INSERT THE D3953-7 GAS SPRING SPACER ONTO THE D3953-3 GAS SPRING AS SHOWN IN VIEW E-E. RAISE THE BASKET LID AND INSTALL THE ROD END OF THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW E-E. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
NOTE: THE D3953-3 GAS SPRING STUD CAN BE HELD IN PLACE WITH A $\frac{9}{16}$ OPEN END SPANNER / WRENCH.
- NOTE:** WITH THE LID IN THE CLOSED POSITION THE GAS SPRING SHOULD NOT BE FULLY COMPRESSED.
- 7) REPEAT STEPS 2 THROUGH 6 AT THE OTHER END OF THE BASKET.
 - 8) TEST THE INSTALLATION. IF INSTALLED PROPERLY THE GAS SPRINGS SHOULD ASSIST THE BASKET USER IN BOTH OPENING AND CLOSING THE BASKET LID.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED (OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

FOR D350-607-043/047 BASKETS REPLACE THE EXISTING D2332-041 PROP ARM ASSEMBLY AS FOLLOWS:

D350-607-143 AUTOMATIC LID OPENER INSTALLATION

NOTE: THIS KIT MAY BE INSTALLED AT EITHER END OF THE BASKET. HOWEVER, THE PROP ARM MUST BE REMOVED IN EITHER CASE AS IT WILL INTERFERE WITH THE FUNCTION OF THE GAS SPRING.

- 1) REMOVE THE D2332-041 PROP ARM.
- 2) GRIND FLUSH THE D2327-3 SPACER BUSHING ON THE END OF THE BASKET WHERE THE LID OPENER IS BE INSTALLED AS SHOWN IN FIGURE 2 (IT IS PERMISSIBLE TO GRIND ALL 4 SPACERS FLUSH). TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4.
- 3) LOCATE THE D3953-15 GAS SPRING BRACKET AS SHOWN IN FIGURE 2. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET LID SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL C. INSTALL THE D3953-15 GAS SPRING BRACKET & D3953-17 GAS SPRING SPACER USING 2X AN3C15A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW G-G.
- 4) LOCATE THE D3953-5 GAS SPRING STUD AS SHOWN IN FIGURE 2. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET BASE SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL D. INSTALL 2X AN3C11A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW H-H. INSTALL THE ROD END OF THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW H-H. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
- 5) INSERT THE D3953-3 GAS SPRING STUD INTO THE D3953-15 GAS SPRING BRACKET & INSERT THE D3953-7 GAS SPRING SPACER ONTO THE D3953-3 GAS SPRING STUD AS SHOWN IN VIEW G-G. RAISE THE BASKET LID AND INSTALL THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD AND FASTEN IN PLACE USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW G-G. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.

NOTE: THE D3953-3 GAS SPRING STUD CAN BE HELD IN PLACE WITH A $\frac{9}{16}$ OPEN END SPANNER / WRENCH.

NOTE: WITH THE LID IN THE CLOSED POSITION THE GAS SPRING SHOULD NOT BE FULLY COMPRESSED.




- 6) TEST THE INSTALLATION. IF INSTALLED PROPERLY THE GAS SPRING SHOULD ASSIST THE BASKET USER IN BOTH OPENING AND CLOSING THE BASKET LID.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

FOR D350-607-045 BASKETS REPLACE THE EXISTING D2332-041 PROP ARM AS FOLLOWS:

D350-607-145 AUTOMATIC LID OPENER INSTALLATION

NOTE: THIS KIT MAY BE INSTALLED AT EITHER END OF THE BASKET. HOWEVER, THE PROP ARM MUST BE REMOVED IN EITHER CASE AS IT WILL INTERFERE WITH THE FUNCTION OF THE GAS SPRING.

- 1) REMOVE THE D2332-041 PROP ARM.
 - 2) GRIND FLUSH THE D2327-3 SPACER BUSHING ON THE END OF THE BASKET WHERE THE LID OPENER IS BE INSTALLED AS SHOWN IN FIGURE 1 (IT IS PERMISSIBLE TO GRIND ALL 4 SPACERS FLUSH). TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4.
 - 3) LOCATE THE D3953-1 GAS SPRING BRACKET AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET LID SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL A. INSTALL THE D3953-1 GAS SPRING BRACKET & D3953-13 GAS SPRING SPACER USING 2X AN3C16A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT AS SHOWN IN VIEW E-E.
 - 4) LOCATE THE D3953-5 GAS SPRING STUD AS SHOWN IN FIGURE 1. TRIM STEEL MESH LOCALLY AS REQUIRED. TOUCH UP PAINT PER ICA-D350-607 REV. 0 SECTION 5.1 ITEM 4. TRANSFER MARK AND DRILL 2X Ø0.194 HOLES THRU THE BASKET BASE SQUARE TUBE STRUCTURE AS SHOWN IN DETAIL B. FASTEN D3953-5 IAW VIEW F-F USING 2X AN3C11A BOLT, 2X NAS1149C0332R WASHER & 2X MS21043-3 NUT.
 - 5) INSTALL 1X D3953-11 GAS SPRING SPACER ONTO THE D3953-5 STUD AS SHOWN IN VIEW F-F. INSTALL THE LARGE END OF THE D3969-1 GAS SPRING SPRING ONTO THE D3953-5 GAS SPRING STUD AND FASTEN IN PLACE USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW F-F. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
 - 6) INSERT THE D3953-3 GAS SPRING STUD INTO THE D3953-1 GAS SPRING BRACKET & INSERT THE D3953-7 GAS SPRING SPACER ONTO THE D3953-3 GAS SPRING AS SHOWN IN VIEW E-E. RAISE THE BASKET LID AND INSTALL THE ROD END OF THE D3969-1 GAS SPRING ONTO THE D3953-3 GAS SPRING STUD USING 1X D3953-9 GAS SPRING WASHER, 1X NAS1149C0432R WASHER, 1X AN310-4 CASTELATTED NUT & 1X MS24665-212 COTTER PIN AS SHOWN IN VIEW E-E. INSTALL COTTER PIN PER MS33540 OR AC43.13 CHAPTER 7-127.
- NOTE:** THE D3953-3 GAS SPRING STUD CAN BE HELD IN PLACE WITH A $\frac{1}{8}$ OPEN END SPANNER / WRENCH.

NOTE: WITH THE LID IN THE CLOSED POSITION THE GAS SPRING SHOULD NOT BE FULLY COMPRESSED.




- 7) TEST THE INSTALLATION. IF INSTALLED PROPERLY THE GAS SPRING SHOULD ASSIST THE BASKET USER IN BOTH OPENING AND CLOSING THE BASKET LID.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

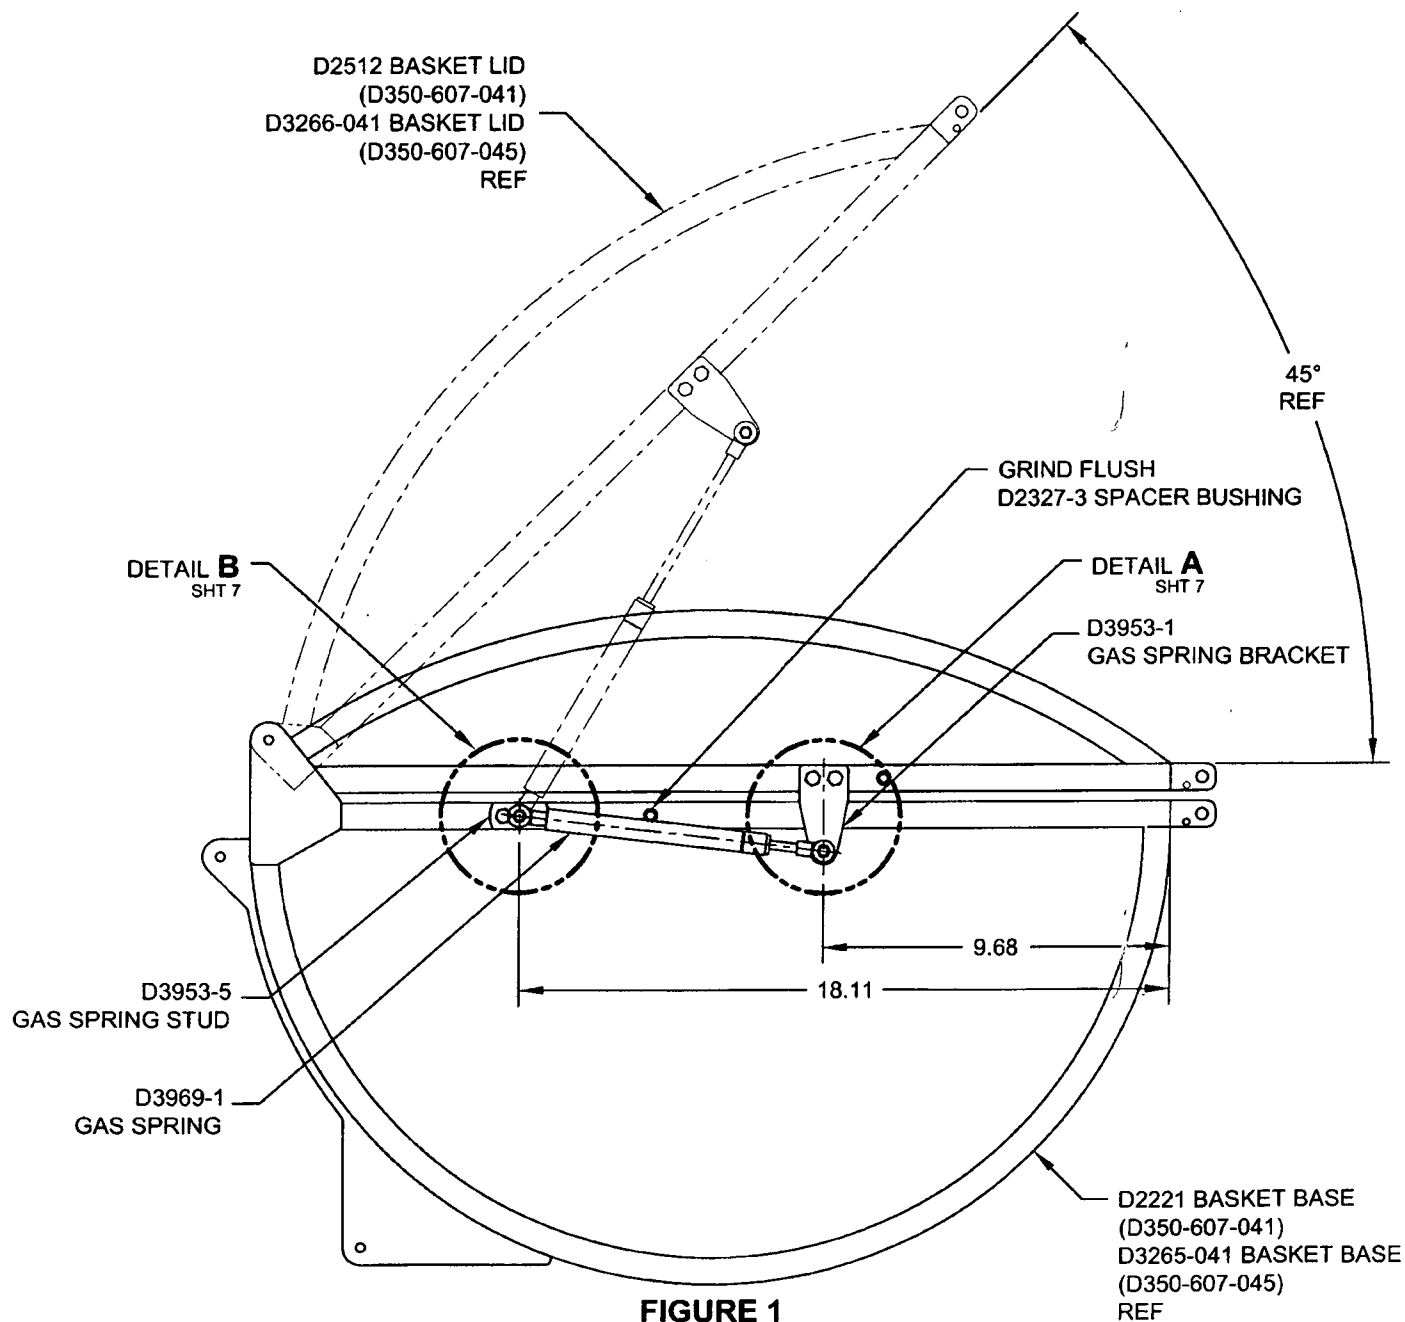


FIGURE 1

D350-607-141 AUTOMATIC LID OPENER INSTALLATION
(BOTH ENDS)

D350-607-145 AUTOMATIC LID OPENER INSTALLATION
(1 END ONLY)

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: *[Signature]*
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 5 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

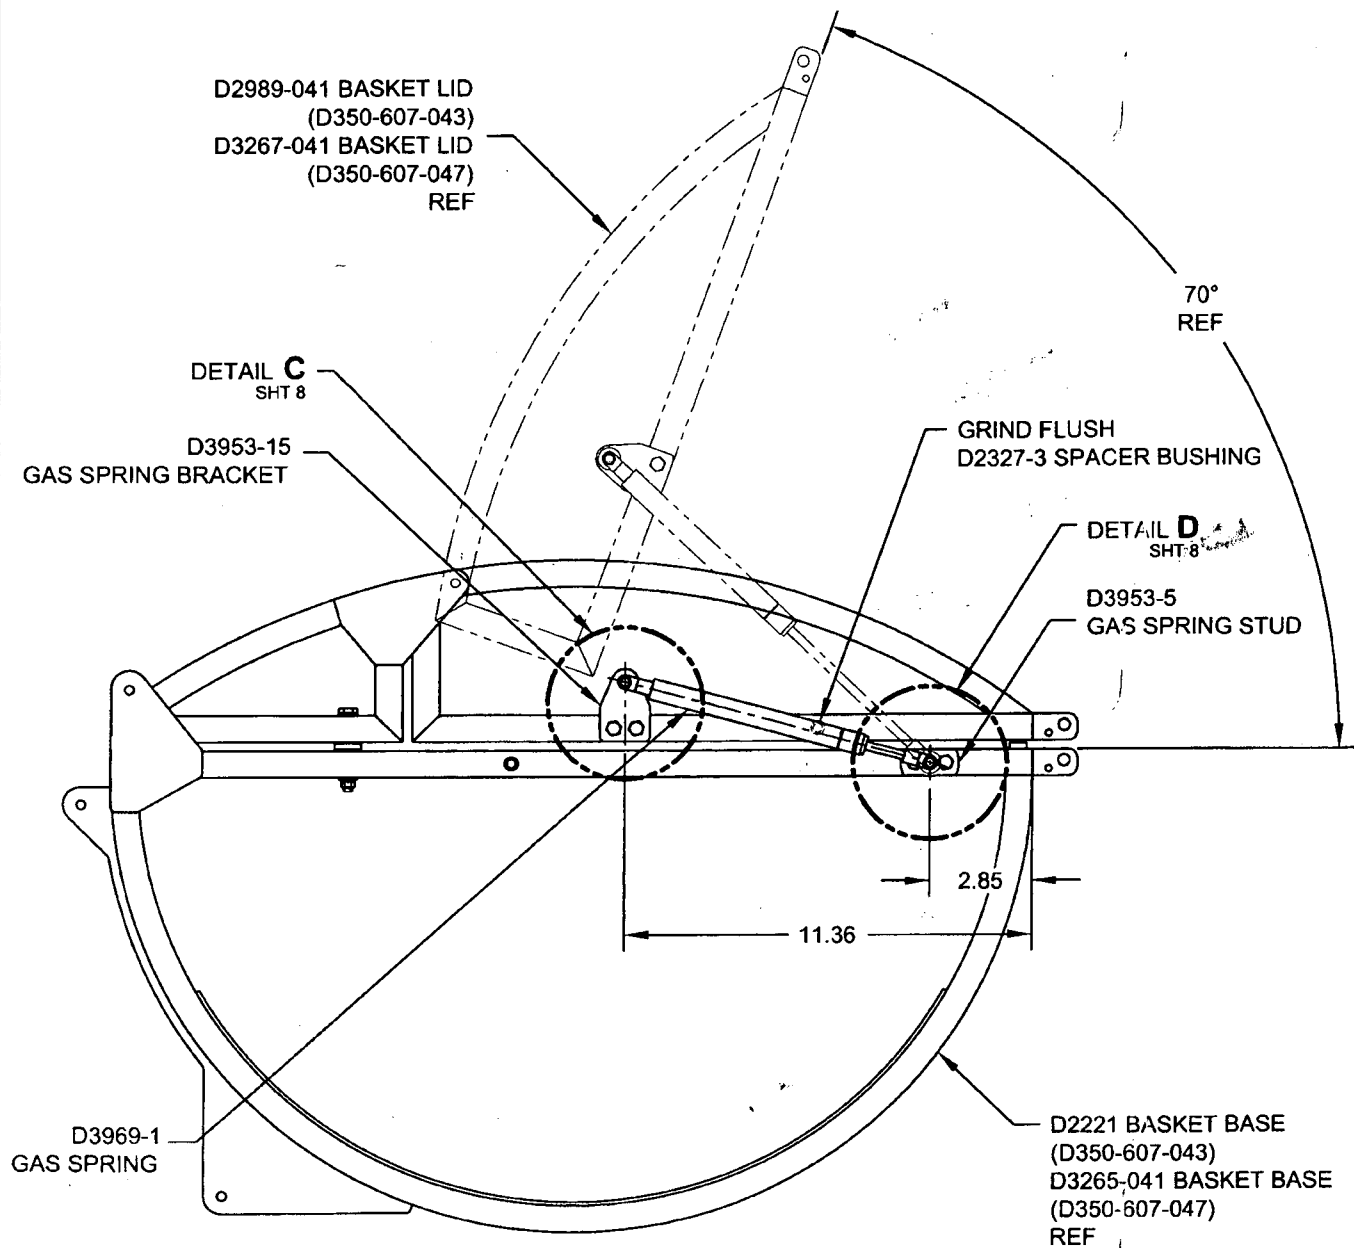


FIGURE 2
D350-607-143 AUTOMATIC LID OPENER INSTALLATION
 (1 END ONLY)

CANADA
 DEPARTMENT OF TRANSPORT
 AIRCRAFT CERTIFICATION
 BRANCH
 DAO # 01-O-01

APPROVED

BY: *[Signature]*
 D. SHEPHERD (DE # 02)

DATE: 09.11.11
 CERT. NO.: SH94-14
 ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 6 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	


AN3C11A BOLT
NAS1149C0332R WASHER
MS21043-3 NUT
2 PL

D3953-5
GAS SPRING STUD
REF

D3953-11
GAS SPRING SPACER

D3953-9
GAS SPRING WASHER

AN310-4 CASTELLATED NUT
MS24665-212 COTTER PIN
NAS1149C0432R WASHER

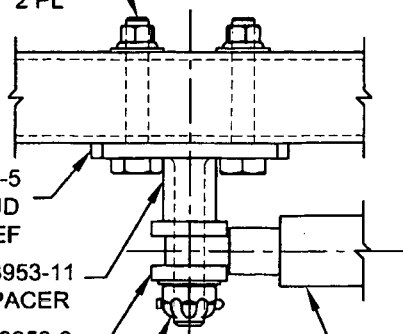

VIEW F-F

AN3C16A BOLT
NAS1149C0332R WASHER
MS21043-3 NUT
2 PL


D3953-13
GAS SPRING SPACER

D3953-1
GAS SPRING BRACKET
REF

D3953-7
GAS SPRING SPACER

D3953-9
GAS SPRING WASHER

D3953-3 GAS SPRING STUD
AN310-4 CASTELLATED NUT
MS24665-212 COTTER PIN
NAS1149C0432R WASHER

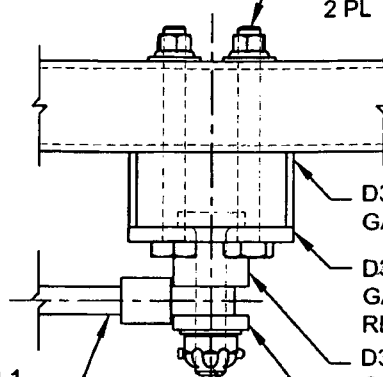


VIEW E-E

D3953-5
GAS SPRING STUD
REF

TRIM MESH LOCALLY
AS REQUIRED

TRANSFER MARK AND
DRILL Ø0.194 THRU
2 PL

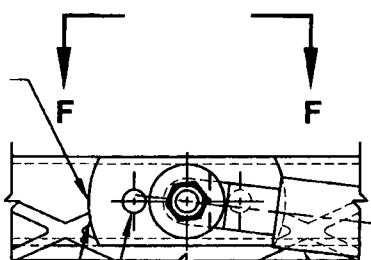


DETAIL B

E

TRIM MESH LOCALLY
AS REQUIRED

TRANSFER MARK AND
DRILL Ø0.194 THRU

D3953-1
GAS SPRING BRACKET
REF

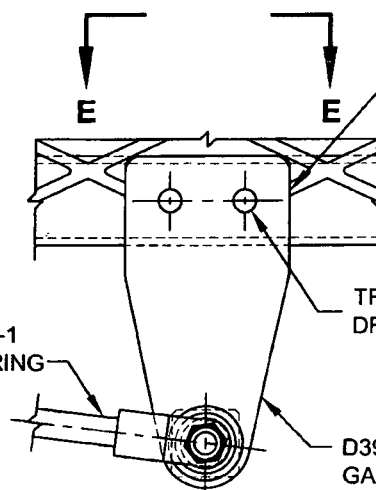




DETAIL A

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: *[Signature]*
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

AN3C15A BOLT
NAS1149C0332R WASHER
MS21043-3 NUT
2 PL

D3953-17
GAS SPRING SPACER

D3953-15
GAS SPRING BRACKET
REF

D3953-7
GAS SPRING SPACER

D3953-9
GAS SPRING WASHER

D3953-3 GAS SPRING STUD
AN310-4 CASTELLATED NUT
MS24665-212 COTTER PIN
NAS1149C0432R WASHER

VIEW G-G

AN3C11A BOLT
NAS1149C0332R WASHER
MS21043-3 NUT
2 PL

D3953-5
GAS SPRING STUD
REF

D3953-11
GAS SPRING SPACER

D3953-9
GAS SPRING WASHER

AN310-4 CASTELLATED NUT
MS24665-212 COTTER PIN
NAS1149C0432R WASHER

D3969-1
GAS SPRING
REF

VIEW H-H

G G

D3953-15
GAS SPRING BRACKET
REF

TRANSFER MARK AND
DRILL Ø0.194 THRU

TRIM MESH LOCALLY
AS REQUIRED

D3969-1
GAS SPRING
REF

DETAIL C

H H

D3953-5
GAS SPRING STUD
REF

TRIM MESH LOCALLY
AS REQUIRED

TRANSFER MARK AND
DRILL Ø0.194 THRU

DETAIL D

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED

BY: *[Signature]*
D. SHEPHERD (DE # 02)

DATE: 09.11.11
CERT. NO.: SH94-14
ISSUE NO.: 4

DESIGN	AJS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. C
MFG. APPR.	N/A	DSI 9473	SHEET 8 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	AUTOMATIC LID OPENER INSTL	NTS
DATE	09.11.11	COPYRIGHT © 2009 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	